

On machines (either commutator or slip ring) most of the brush heat losses are dissipated by convection and, generally, it is the air which serves as a cooling agent.

01 – AIR FLOW

The air flow should be proportional to the losses to be dissipated, and to calculate this air flow one generally uses the formula:

$$Q_v = \frac{P_t}{0.279 \times \rho \times \Delta T}$$

Where:

Q_v is the air flow, in cubic meters/h

P_t is the total losses to be dissipated, in watts (for brush losses see TDS-05)

ρ is the air density, in kg/cubic meter of air, which is a function of temperature and altitude (pressure)

ΔT is the difference in the air temperature between the inlet and outlet of the machine, in °C

REMARK

For the determination of air density, formulas or abacus may be found easily on the internet.

The value at 20°C at sea level (0 to 100 m altitude) is 1.204 kg/cubic meter of air. Therefore the formula above may be simplified:

$$Q_v = \frac{P_t}{0.34 \times \Delta T}$$

Actually, a ventilation system is considered as being efficient when the temperature difference ΔT between the inlet and the outlet of the air is between 10 and 25 °C.

The necessary air flow can also be estimated according to the machine power since the losses are roughly proportional to the power.

Therefore for a motor with forced ventilation, one usually considers 6 to 15 cubic meters/h (0.10 to 0.25 cubic meters/min) for each power kW in continuous operation.

02 – VENTILATION TYPES

In fact, according to the operation conditions, the power and environment, **the heat losses can be dissipated as follows:**

DIRECTLY:

In this case the air for cooling the windings and brushes enters at one end and leaves at the other one. The **motors are self-ventilated or equipped with motor fans with filters** to trap the dust in the circulating air.

It is recommended **that the air should cross the motor from the windings to the commutator direction**, and thus prevent wear dust from being drawn into the windings.

This device may also help to maintain the temperature of the commutator or slip ring to a suitable level, particularly in case of low load operation

MERSEN PROPERTY

BY AN AIR-COOLING SYSTEM:

The cooling air of the windings and brushes is **recycled through filters** (see Technical Note TDS-24) **and an air-air exchanger**. The external air is forced into the exchanger by a motorized fan.

The air-cooling system is often equipped with an auxiliary fan in order to produce overpressure and ensure the replacement of the hot air.

Experience shows that brush wear is often reduced when the air is partially renewed.

In addition the use of a MERSEN DustCollector device, which is designed for removing dust arising from brush wear, may help to cool down the system.



MERSEN DUSTCOLLECTOR, A NEW INNOVATION PATENTED BY MERSEN

Dust extraction system integral to the brush-holder

- No machine modification required
- Standard product that can be customized
- A complete solution for original equipment or retrofit

BY A WATER-COOLING SYSTEM:

The cooling air of windings and brushes is **recycled through filters** (see Technical Note TDS-24) **and an air-to-water exchanger** similar to an automobile radiator.

As in the previous case and for the same reason the system is equipped with an auxiliary fan.

Whatever the cooling method the following should be borne in mind:

- The most favorable temperature for a commutator (in operation) is between 50°C and 70°C:
 - A cold commutator does not always build up film under the brush. An excess of cool and dry air leads to the effect of streaking or stripes in the brush tracks as well as irregular wear of the metal of the ring or commutator. It is not recommended to operate below 40 °C.
 - Above 90°C (although above 100°C is seldom found in industrial machines), we generally admit that the film is modified due to the decrease of the humidity level. It leads to an increase in brush wear. This situation is becoming more common with newer machines as they get smaller, but should be avoided with appropriate cooling.
- The humidity also disturbs the brush operation (please refer to technical note TDS-17).
 - Too cold air, besides the disadvantages stated above, will be too dry. In fact, under 5 g of water per cubic meter of air*, the skin does not develop and the brush wear increases.
 - At the opposite, with an excess of humidity, above 5 g of water per cubic meter of air*, the skin gets thicker, preferential areas for electric current path appear and generate streaking and stripes on the commutators or slip rings.
 - * This rate can vary depending on brush grades and their possible impregnations.
- It shall be noticed that, when air is not renewed, oxygen and humidity levels decrease, with an increase in friction and therefore brush wear (see TDS-15).

List of citations:

TDS-05: Losses in carbon brushes **TDS-15:** Brush wear **TDS-17:** Air humidity **TDS-24:** Dust arising from brush wear

The specifications or data contained in present catalogue are only given for information and do not create any undertakings whatsoever. Any copy, reproduction or translation, either partially or fully, of these information is subject to the Mersen's prior written consent. In addition, due to the continuing improvement of techniques and change of applicable standards, Mersen is entitled to modify at any time the characteristics and specifications of its products as described in present catalogue.

Contact: info.ptt@mersen.com

MERSEN PROPERTY